


EZ-600-NMH-RA (stock code: 3190-762)

Type N-Male Plug Right Angle

Non-solder center contact Crimp-on (.610" hex.) outer contact

INSTALLATION INSTRUCTIONS


(Cable Types: LMR-600; 600 DB; 600 FR)

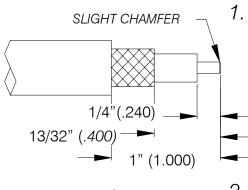


- 1. (A) Trim cable to dimensions shown using a razor knife or Times ST-600EZ strip tool.
 - (B) Remove any residual plastic from center conductor.
 - (C) Deburr center conductor using a fine file or Times DBT-01 tool.



2. (A) Slide weather seal and crimp ferrule over cable.

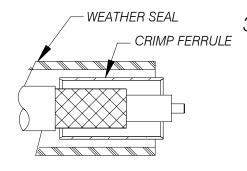

STEP 2

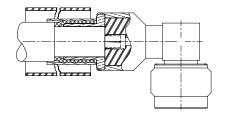

- 3. (A) Flare braid and insert cable into connector body until dielectric is seated with braid wires on outside of connector body and aluminum tape inside connector body.
 - (B) Braid should assemble flush to within 1/16" (.06) of connector shoulder. Trim braid as necessary.
 - (C) Slide crimp ferrule over braid and crimp as close to body as possible using die indicated in a Times HX-4 crimp tool or equivalent.

 Do not crimp rear of crimp ferrule.
 - (D) Heat shrink weather seal over rear of connector body and down on to cable jacket using hot air gun.